




OPERATION INSTRUCTION

Digital 3-purpose Snap Gage

Attention:This caliper is not waterproof. If there is coolant liquid on the sticker, the reading may be incorrect. Please clean the sticker with dry cloths. If the problem is not solved, please use WD40 to clean the sticker.

Measuring range: 0-25mm/0-1"
Resolution: 0.01mm/0.0005"
Accuracy: ± 0.03 mm
Battery: LR44

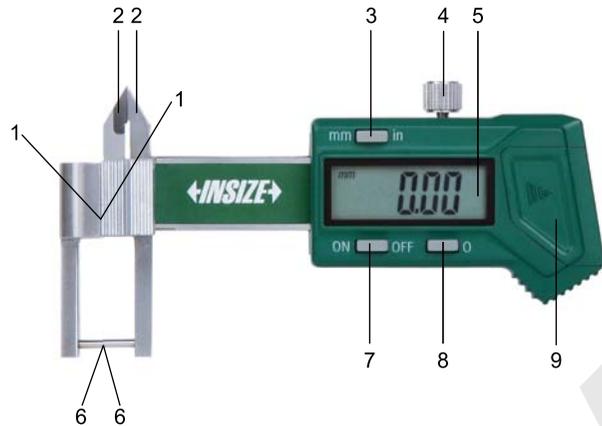

1-External measuring faces
2-Internal measuring jaws
3-'mm/in' button
4-Locking screw
5-LCD display

6-Groove tips
7-'ON/OFF' button
8-'0' button
9-Battery cover

1. Install battery:

- Remove the battery cover (fig.1)
- Put LR44 battery into battery house, the positive side of battery (+) should face out (fig.2)
- Close the battery cover (fig.3)

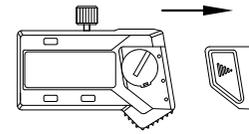


fig.1

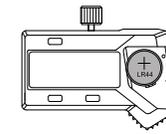


fig.2

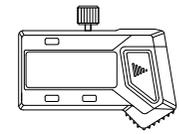


fig.3


2. Buttons

mm/in---mm and inch conversion
ON/OFF---turn on/off display
0---set zero.

3. Zero setting

Combine external measuring faces, short press "0" button to set zero.
Gage should be checked regularly to make sure that it is properly zero set.

4. Measurement

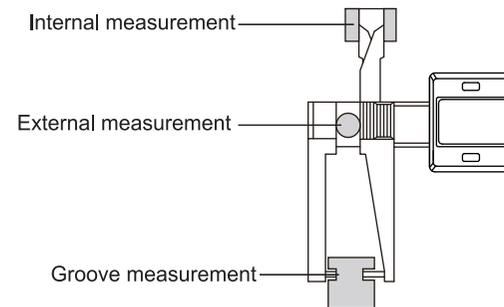

5. One battery can last for one year use. When battery voltage is too low, digits on display flash, please replace battery. If the gage is not be used for a long period of time, please remove the battery. Otherwise, liquid may leak from the battery and damage the gage.

6. Working temperature is 0-40°C/32-104°F, relative humidity should not exceed 80%.

MN-2164-C/E

V1