




OPERATION INSTRUCTION

Large Shank Diameter Electronic Edge Finder

Caution: Prevent liquid from getting into edge finder to damage electronics

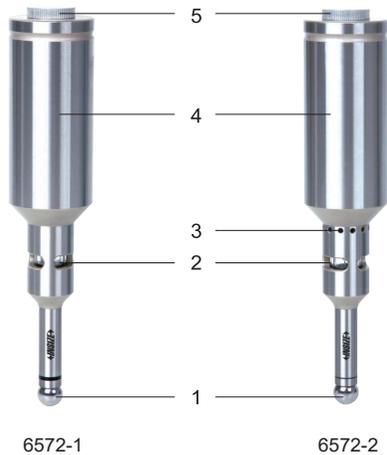

- 1-Contact ball(SØ10mm)
- 2-LED light
- 3-Beeper
- 4-Shank
- 5-Battery cover

1. Put one battery(23A, 12V) in, the negative side of battery should face up(fig.1). Confirm the lighting of LED light and the sounding of beeper(6572-2) with touching A-B part with a metal material(fig.2).

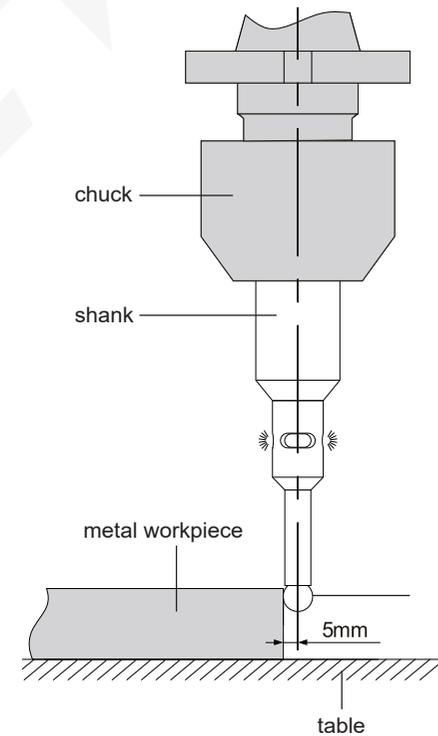
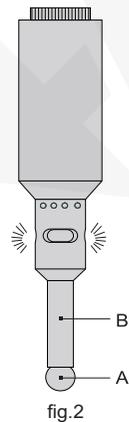
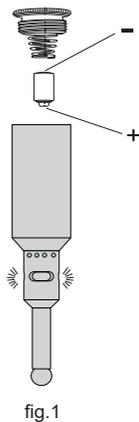


fig.3

2. The shank is electrically conducted to the metal workpiece through the chuck and table, the LED lights up and the beeper(6572-2) sounds, when the ball touches the workpiece gently(fig.3). Right now, the distance between edge finder axis and metal workpiece surface is 5mm.

Caution: When fastly move the edge finder to the LED lights up, please make a slight backto the lights out, and then slowly move to the lights up, to ensure accuracy.

3. Not suitable for rotary use.

MN-6572-E

V0